




Držá pro šroubovací frézy

Chuck for threaded type cutter

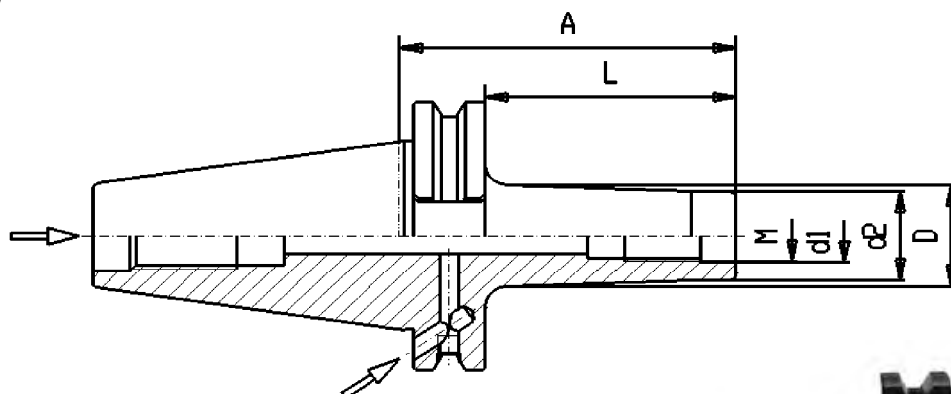

Form AD/B

Artikel-Nummer

	SK	x	závit	x	A	d2	L	D	d1	
SK 50	G347D	50	x	M 8	x	69	13	50	23	8,5
	G347D	50	x	M 8	x	119	13	100	25	8,5
	G347D	50	x	M 8	x	169	13	150	30	8,5
	G347D	50	x	M 10	x	69	18	50	23	10,5
	G347D	50	x	M 10	x	119	18	100	32	10,5
	G347D	50	x	M 10	x	169	18	150	38	10,5
	G347D	50	x	M 12	x	69	21	50	24	12,5
	G347D	50	x	M 12	x	119	21	100	31	12,5
	G347D	50	x	M 12	x	169	21	150	41	12,5
	G347D	50	x	M 16	x	69	29	50	34	17
	G347D	50	x	M 16	x	119	29	100	41	17
	G347D	50	x	M 16	x	169	29	150	50	17

vyváženo /balanced - G6,3 bei 15.000 U/min

Příslušenství / Accessories

Prodloužení/ Extensions
Redukce / reductions



G047

Tažný čep / Pull studs



G050